

	1	2	3	4	5	6		
8	82	557-35-01	557-35-01	557-35-01	557-35-01	557-35-01	557-65-00	
	81	БКТ	АВ	ОПП	А	МП	НОС1	
		БКТ	НМШМ-1120	НМШМ1-1120	АШ2-12/24	НМШМ1-1120	НМШ1-400	
7	72 СМБ	13553-00-00Б	13553-00-00Б	13553-00-00Б	13553-00-00Б-05	13553-00-00Б	13553-00-00Б	
		Ч2ИП1	ЧОВ	БК7	Ч2ИП	БК8	ЧЗИП	
		НМШ2-4000	НМШ1-1440	КБМШ-5	НМШ1-1440	КБМШ-5	НМШ2-4000	
	71	13553-00-00Б-01	13553-00-00Б	13553-00-00Б-07	13553-00-00Б	13553-00-00Б-07	13553-00-00Б-01	
		Ч1Н	Ч1Н1	Ч2Н	Ч1Н2	К50-35-25Вт	К50-35-25Вт	
		НМШ1-400	НМШ1-400	НМШ1-1440	НМШ1-400	С1,С2-1000	С1-1000	
6	63 СПБ	13553-00-00Б	13553-00-00Б	13553-00-00Б	13553-00-00Б	14881-01-00-01	14881-01-00-01	
		1П	2П	ЧСП1	ЧСП	ПА	ЧСА	
		1Н-340	1Н-340	1Н-340	1Н-340	1Н-1350	2Н-2250	
	62 СМБ	24541-00-00-01	24541-00-00-01	24541-00-00-01	24541-00-00-01	24541-00-00	24541-00-00-12	
		ЧОИП	БКМ	ЧПС1	Н1РУ	Н2РУ	МЧСП1	
		1Н-1350	2Н-2250	1Н-1350	1Н-1350	2Н-2250	1Н-1350	
	61	24541-00-00	24541-00-00-12	24541-00-00	24541-00-00	24541-00-00-12	24541-00-00	
		2ПК	2МК	1ПП	ПЧПРУ	ЧК	ЧСС	
		1Н-1350	1Н-1350	1Н-1350	2Н-2250	1Н-1350	2Н-2250	
	5	52	КОММУТАЦИОННЫЕ КЛЕММЫ					557-40-00
		51	КОММУТАЦИОННЫЕ КЛЕММЫ					557-40-00
	4	42 СПБ	ЧПС	ОЧС	ЧПП	ЧПЛС	МЧСП	С5-35В-25Вт
НМШ1-1440			НМШ1-1440	НМШМ2-1500	НМШ1-1440	НМШТ-1440	R1,R2-1.5К;R3,R4-47	
13553-00-00Б		13553-00-00Б	13553-00-00Б-01	13553-00-00Б	13553-00-00Б	557-110-00		
41		НзП1	НзП2	НзП	ЧКП	ЧВСН	С5-35В-25Вт	
	НМШМ4-105/1000	НМШ1-7000	НМШ2-4000	НМШМ4-105/1000	НМШ1-1440	R1-R4 - 47		
3	31	13553-00-00Б-03	13553-00-00Б	13553-00-00Б-01	13553-00-00Б-03	13553-00-00Б	557-110-00	
		ПС	ЧН	ЧСП	НЛ	Регулир.резисторы		
	КШ1-600	КШ1-800	ППШ-3	КШ1-280	1хРР-100;2хРР-400			
2	22	2170-00-00А	2170-00-00А	2170-00-00А-04	2170-00-00А	55783-00		
	21							
1	11	зКТ	1Т		С		557-10-13	
		ЭКПТ-УС-1 "з"	ЭКПТ-УС-1 "515"		СОБС-2МП			

Статив двухсторонний СУР2-2 чертеж №557-00-00  
Ось поворота рамок справа

	Стадия	Лист
	Р	1
	Листов	13
Комплектация и монтажные схемы статива №23		

6			5			4			3			2			1		
<del>№№ КОИТ</del>			№№ КОИТ.	C		<del>№№ КОИТ</del>			<del>№№ КОИТ.</del>			№№ КОИТ.	1Т		№№ КОИТ.	3КТ	
			II	22-52-20-2								з1	22-41-К67		ПКЖ1	22-41-К69	
			I2	I3								Ж1	22-41-К65		ПКЖ2	634-13	
			I3	I2								КЖ1	22-41-К63		ОПКЖ1	51-К71 ОПКЖ2	ППК
			I4	634-83 51-К30	OX							з2	22-324-72		ОПКЖ2	2-Оз1 ОПКЖ1	ППК
			III1	III1								Ж2	314-123		ХТ2-3	2-ХТ2-2	22-114-ХТ2-3
			II2	III2								КЖ2	625-33		ХТ2-7	52-К22	
			III1	22-52-4-2 II1								Оз1	1-ОПКЖ2 ОЖ1	ППК	0	22-811-71	
			III2	II2	V4							ОЖ1	ОКЖ1 Оз1	ППК	220	22-52-18-2	
			V2	51-К18 814-32	МСХ							ОКЖ1	Оз2 ОЖ1	ППК			
			V4	III2								Оз2	ОЖ2 ОКЖ1	ППК			
												ОЖ2	ОКЖ2 Оз2	ППК			
												ОКЖ2	22-113-ОКЖ2 ОЖ2	ППК			
												0	632-63				
												220	22-52-12-2				
												ХТ2-3	52-К26	1-ХТ2-3			
												ХТ2-7	52-К18				

Вид с монтажной стороны

6			5			4			3			2			1		
№№ КОНТ.			№№ КОНТ.	Рег.резисторы		№№ КОНТ.	НЛ		№№ КОНТ.	ЧСП		ЧН		№№ КОНТ.	ПС		
						1	52-K110		1	635-31	22-41-K113	1	2	22-715-43	1	815-21	
						2	3		2	426-22 22-41-K140	ЧСМ	2	1		2	11	
						3	2		3	22-516-2	22-41-K138	3	4		3	22-42-K146	
					R1	4	52-K108		4	22-52-23-1		4	3	22-715-42	4	22-42-K126	
			12	634-31		12	52-K2		12	22-52-9-2		12	413-4	711-13	12	111	
			11	42III-1	СПБ	11	422-42		11	635-12		11	411-22		11	2	
					R2	13			13	51-K20	МСХ	13			13		
			22	415-21		22	22-312-12		22	72		22	712-42		22	121	
			21	22-612-11		21	2-143	22-312-11	21			21	113	712-41	21	22-42-K150	
					R3	23			23			23			23		
			32	52-K67		32	22-513-12					32			32		
			31	22-724-41		31	42III-2	СПБ				31			31	22-42-K140 41	ПБМ
						33						33			33	815-12	
						42	22-312-42					42			42	815-41	
						41	421-43	22-312-41				41			41	31 113	ПБМ
						43						43			43	22-42-K132	
						112	712-31					112	713-4		112	22-32III-7	СМБ
						111	22-324-32					111	42III-29	СПБ	111	12	
						113						113	21		113	41	ПБМ
						122	724-71					122			122	22-52-7-2	
						121	625-32					121	42III-30	СПБ	121	22	
						123	112-Ж2	724-73				123	22-724-4		123	22-52-5-2	
						132	712-51		72	22	83	132			132	22-52-5-1 51-K36	ПБСК
						131	52-K1		71			131	712-82		131	815-31	
						133			73			133	422-41		133	22-52-7-1 51-K38	МБСК
						142	22-326-42		82	635-11		142			142	22-42-K128	
						141	724-52		81	635-13		141	421-33		141	815-43	
						143			83	72		143	4-21		143	22-42-K130	

Вид с монтажной стороны


6			5			4			3			2			1		
№№ КОНТ.	Резисторы		№№ КОНТ.	ЧВСН		№№ КОНТ.	ЧКП		№№ КОНТ.	НЗП		№№ КОНТ.	НЗП2		№№ КОНТ.	НЗП1	
			1	23-32III-9	СМБ	1	711-63		1	22-32III-8	СМБ	1	426-21		1	615-32	
			2	3		2	722-62		2	3		2	425-32		2		
			3	2		3	711-83		3	2		3	22-612-13	615-33	3	426-12 22-516-1	ЧСП
	R1		4	615-22		4	722-12		4	312-12	6-12	4	426-11		4		
12	3-4		12	722-11		12						12			12		
11	723-12		11	22-612-12		11						11			11		
	R2		13	711-81		13						13			13		
22	724-4		22	32		22	722-21		22			22	1-22		22	2-22	312-11
21	725-52		21	315-22		21	42III-4	СПБ	21			21	42III-27	СПБ	21	42III-28	СПБ
	R3		23	22-713-11					23			23					
32	726-4		32	22		32						32			32		
31	725-12		31	22-42-K74		31	23-41-K132	722-31				31			31		
	R4		33	22-42-K78		33	722-32	5-81				33			33		
42	421-51		42	52		42	22-715-11		42	4-52		42			42		
41	42III-2	СПБ	41	22-42-K76		41	22-632-81		41	711-22		41			41		
			43	22-42-K80					43	714-42		43					
			52	42		52	22-42-K46	3-42				52			52		
			51	22-612-31		51	711-23					51			51		
			53	22-713-31		53	714-43					53			53		
			62	722-61		62			62			62			62		
			61	22-612-32		61			61			61			61		
			63	711-61					63			63					
			72	722-71		72						72			72		
			71	22-632-83		71						71			71		
			73	22-814-71		73						73			73		
			82	722-4		82			82			82			82		
			81	4-33		81			81			81			81		
			83						83			83					

Вид с монтажной стороны

6			5			4			3			2			1		
№№ КОТ.	Резисторы		№№ КОТ.	МЧСП		№№ КОТ.	ЧПЛС		№№ КОТ.	ЧПП		№№ КОТ.	ОЧС		№№ КОТ.	ЧПС	
			1	22-32III-25	СМБ	1	22-42-К6		1	4-11	СМБП	1	22-32III-24	СМБ	1	22-32III-23	СМБ
			2			2	3					2	3		2	3	
			3			3	2		3	22-42-К12		3	2		3	2	
	R1		4			4	21					4	6-31	623-31	4	12	
12	713-41 411-3	ЧСП	12	626-2		12	634-72	52-К95				12			12	4	22-611-41
11	412-4		11	III-5	СПБ	11	3-1 51-К63	СМБП				11			11	6-41	
	R2		13			13	1-31					13			13	22-722-11	
22	615-82 313-2	ЧСМ	22			22	22-42-К10	3-22	22	4-22		22	22-812-11		22	22-812-21	
21	412-1		21			21	4	3-21	21	4-21		21	22-311-21		21	22-324-52	
	R3		23			23			23			23			23		
32	715-12		32	412-2	615-83	32	22-313-4					32	III-23	СПБ	32	22-615-11	
31	2-4		31	22-612-33		31	52-К83					31	22-722-33		31	4-13	
	R4		33			33	22-632-31					33			33	312-141	
42	716-12		42			42	3-43		42			42	314-11		42	22-614-71	
41	1-11		41	52-К30		41	22-812-42 51-К33	СПБП	41	52-К87		41	312-133	22-326-41	41	4-43	
			43	22-612-63		43	1-41		43	4-42		43			43	314-41	
			52			52						52			52		
			51	61		51						51			51	22-311-81	416-42
			53			53						53			53	22-722-81	
			62			62			62			62	22-624-81		62	22-722-22	
			61	51	634-32	61			61			61	623-12		61	III-25	СПБ
			63			63			63			63			63	22-615-21	
			72	22-32III-26	СМБ	72						72	III-24	СПБ	72		
			71			71						71	22-326-13		71	621-62	
						73						73	22-515-42		73	621-51	
			82	621-81	22-713-71	82			82			82			82	623-2	
			81	22-636-2		81			81			81			81	III-26	СПБ
			83	22-612-82		83			83			83			83		

Вид с монтажной стороны





42III-СПБ

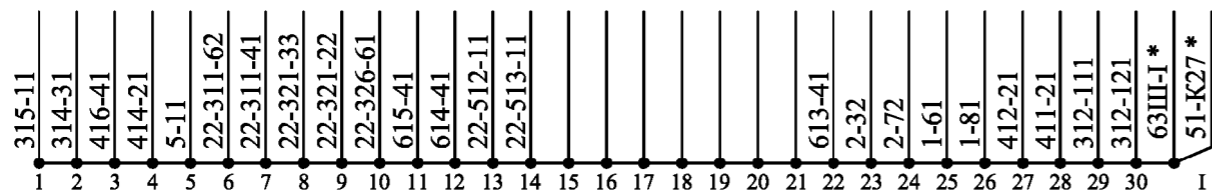

Полка №42  
Статив №23

Лист

5

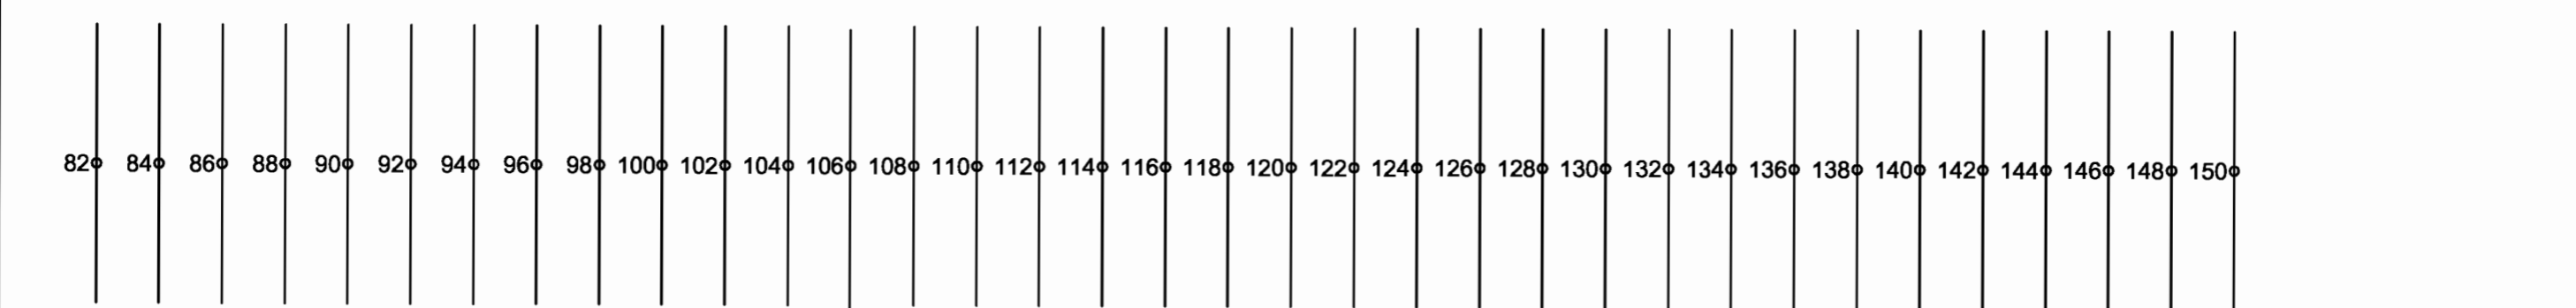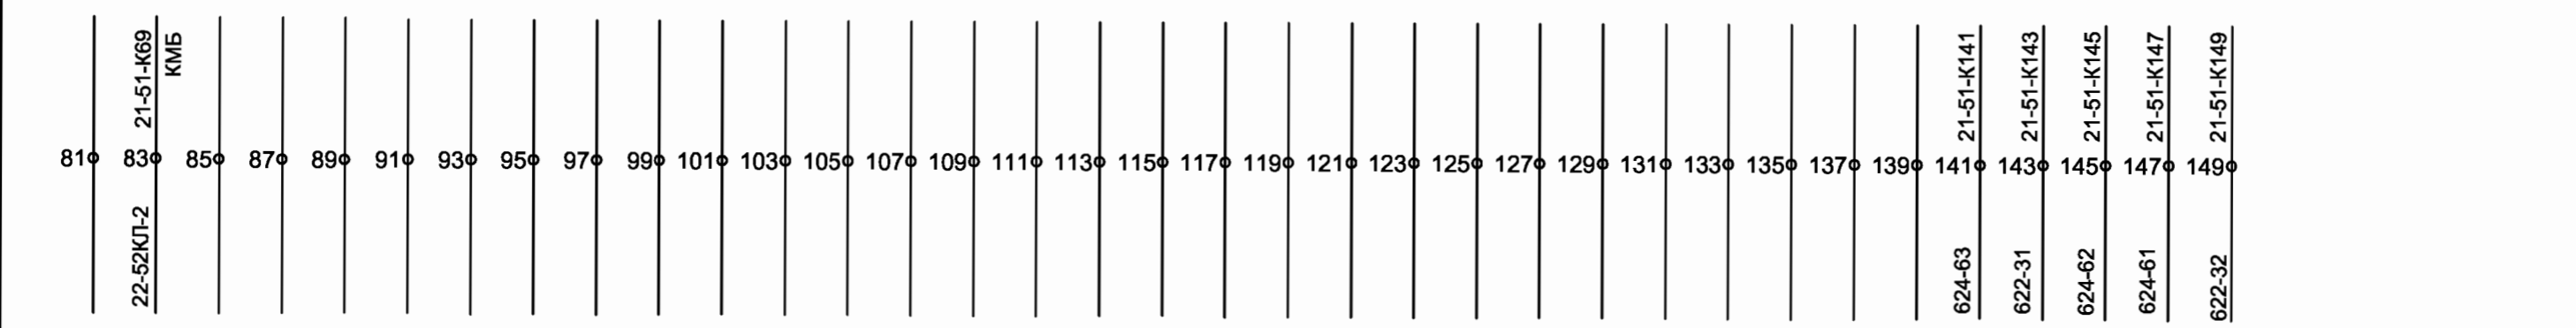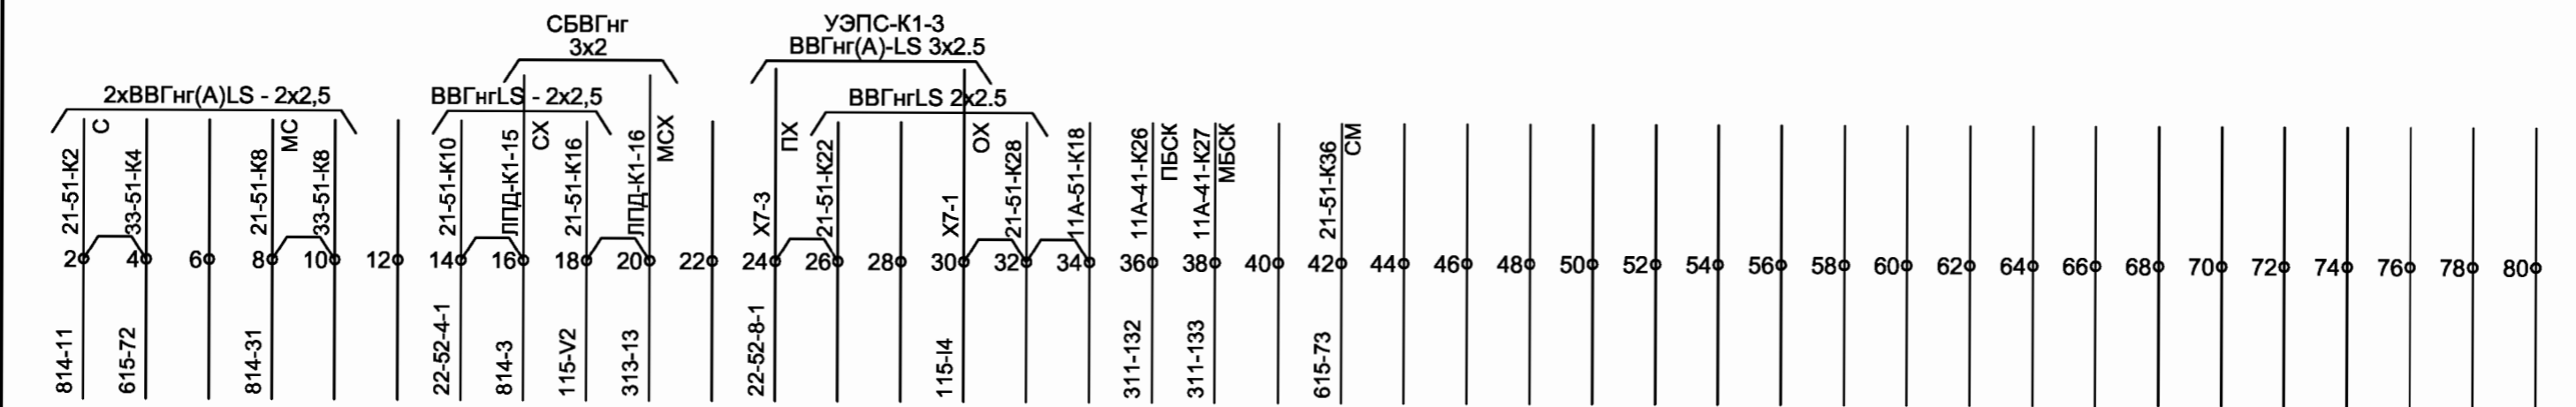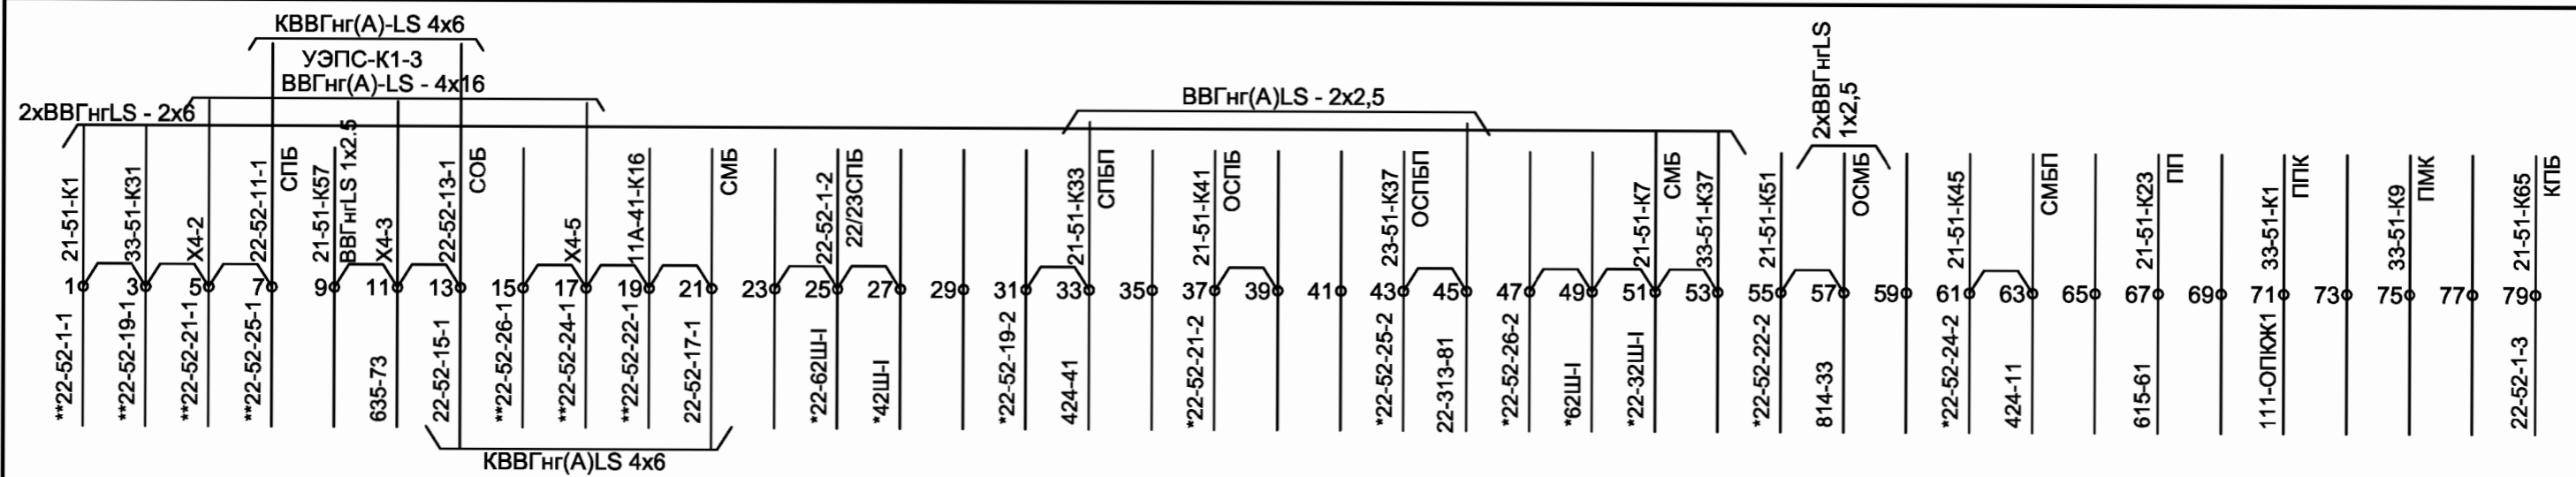

\* - монтировать проводом 2,5 мм.кв.  
 \*\* - монтировать проводом 6 мм.кв.  
 \*\*\* - монтировать проводом 1,5 мм.кв.

22-715-32	82	33-52-K82	81	11A-41-K50	22-314-4	81	314-12	2	33-52-K2	314-131	→	11A-41-K1
613-11	84	33-52-K84	83	11A-41-K51	424-31	83	22-812-71	4	33-52-K4	22-324-31	↻	11A-41-K2
613-12	86	33-52-K86	85	11A-41-K52	22-326-4	85	22-812-73	6	33-52-K6	22-811-21	↻	11A-41-K3
632-51	88	33-52-K88	87	11A-41-K53	423-41	87	22-812-13	8	33-52-K8		7	
632-52	90	33-52-K90	89	11A-41-K54	22-324-62	89	22-812-23	10	33-52-K10	22-824-1	↻	11A-41-K23
632-11	92	33-52-K92	91	11A-41-K55	622-42	91	22-626-22	12	33-52-K12	ЧМД		
632-12	94	33-52-K94	93	11A-42-K56	22-632-52	93	22-622-42	14	33-52-K14	22-321-41	↻	11A-41-K6
613-21	96	33-52-K96	95	11A-41-K57	424-12	95	22-812-33	16	33-52-K16	22-811-11	↻	11A-41-K7
613-22	98	33-52-K98	97			97	112-XT2-7	18	33-52-K18	631-23	↻	11A-41-K8
22-724-51	100	33-52-K100	99			99	22-114-XT2-7	20	33-52-K20	22-811-41	↻	11A-41-K9
22-611-52	102	33-52-K102	101			101	111-XT2-7	22	33-52-K22	631-2	↻	11A-41-K10
616-62	104	33-52-K104	103			103	22-113-XT2-7	24	33-52-K24	631-1	↻	11A-41-K11
22-325-21	106	33-52-K106	105			105	112-XT2-3	26	33-52-K26	632-2	↻	11A-41-K12
314-4	108	33-52-K108	107			107		28		632-1	↻	11A-41-K13
314-1	110	33-52-K110	109			109	425-41	30	33-52-K30	633-4	↻	11A-41-K14
22-724-83	112	33-52-K112	111			111	711-51	32	33-52-K32	634-1	↻	11A-41-K15
22-513-4	114	33-52-K114	113			113	22-712-52	34	33-52-K34		31	
22-513-1	116	33-52-K116	115			115	615-42	36	33-52-K36		33	
22-513-21	118	33-52-K118	117			117		38			35	
22-513-122	120	33-52-K120	119			119		40			37	
22-514-52	122	33-52-K122	121			121	22-621-33	42	33-52-K42		39	
22-514-72	124	33-52-K124	123			123	22-626-73	44	33-52-K44		41	
22-814-73	126	33-52-K126	125			125	714-11	46	33-52-K46		43	
22-724-11	128	33-52-K128	127			127	712-62	48	33-52-K48	22-625-41	↻	11A-41-K58
22-515-11	130	33-52-K130	129			129	613-42	50	33-52-K50	22-622-21	↻	11A-41-K59
22-816-13	132	33-52-K132	131			131	632-42	52	33-52-K52	634-21	↻	11A-41-K60
22-52-1-2	134	33-52-K134	133			133	22-614-52	54	33-52-K54	22-824-2	↻	11A-41-K65
22/23СПБ	136	33-52-K136	135			135	614-31	56	33-52-K56	22-512-61	↻	11A-41-K67
22-41-K140	138	33-52-K138	137			137	22-515-41	58	33-52-K58	22-512-21	↻	11A-41-K68
ЧСМ	140		139			139	22-326-83	60	33-52-K60	22-711-11	↻	11A-41-K69
722-13	142		141			141	22-614-82	62	33-52-K62	22-711-21	↻	11A-41-K70
ЧСП	144		143	11A-51-K55	622-52	143	22-624-82	64	33-52-K64	22-713-12	↻	11A-41-K39
	146		145	11A-51-K47	812-41	145	22-622-62	66	33-52-K66	22-713-32	↻	11A-41-K40
	148		147	11A-51-K5	632-73	147	22-624-62	68	33-52-K68	315-32	↻	11A-41-K41
	150		149	11A-51-K6	631-13	149	22-623-32	70	33-52-K70	22-724-61	↻	11A-41-K42
							22-816-23	72	33-52-K72	22-813-51	↻	11A-41-K43
							22-323-31	74	33-52-K74	22-321-1	↻	11A-41-K44
							22-322-73	76	33-52-K76	626-13	↻	11A-41-K45
							22-724-71	78	33-52-K78	22-321-52	↻	11A-41-K46
							22-715-33	80	33-52-K80	812-11	↻	11A-41-K47

- \* - монтировать проводом 2,5 мм.кв.
- \*\* - монтировать проводом 6 мм.кв.
- \*\*\* - монтировать проводом 1,5 мм.кв.

6			5			4			3			2			1		
№№ КОИТ.	ЧСС		№№ КОИТ.	ЧК		№№ КОИТ.	ПЧПРУ		№№ КОИТ. 1	1ПП		№№ КОИТ.	2МК		№№ КОИТ.	2ПК	
1	62III-1	СМБ	1	62III-2	СМБ	1	62III-4	СМБ	1	62III-30	СМБ	1	22-41-K127		1	22-41-K129	
2	32		2	22-42-K18		2	22-311-61		2	631-71		2	22-41-K131		2	22-41-K133	
3	4		3	4		3	4		3	4		3	4		3	4	
4	3		4	3		4	3		4	3		4	3		4	3	
			12						12	52-K86		12	22-625-2		12	622-2	
			11						11	52-K84		11	1-11		11	2-11	22-321-31
			13						13			13			13		
			22	415-4					22	52-K98		22			22		
			21	22-41-K134					21	52-K96		21			21		
			23						23			23			23		
32	22-41-K137	2	32	411-1		32	62III-3	СМБ	32			32			32		
31	22-41-K135		31	711-82		31	52-K56		31			31			31		
33			33	412-3		33	22-326-11		33			33			33		
42			42	52-K36		42			42	52-K50		42	22-42-K68		42	22-42-K70	
41			41	42III-11	СПБ	41	42III-12	СПБ	41	42III-22	СПБ	41	1-41 5-72	С	41	631-83 2-41	С
43						43	22-326-81										
52			52			52	22-711-22		52			52			52		
51			51			51	22-624-72		51			51			51		
53						53											
62	52-K104		62			62	22-711-12		62			62			62		
61	626-51		61	22-812-2 51-K67	III	61	22-624-42		61			61			61		
63			63	22-323-72		63			63			63			63		
			72	2-41 51-K4	С				72			72			72		
			71	22-42-K48					71			71			71		
			73	22-633-32 51-K42	СМ				73			73			73		
			82	713-51 426-22	ЧСМ				82			82			82		
			81	711-62					81			81			81		
			83	425-32					83			83			83		


Вид с монтажной стороны



6			5			4			3			2			1		
№№ КОИТ.	МЧСП		№№ КОИТ.	Н2РУ		№№ КОИТ.	Н1РУ		№№ КОИТ.	ЧПС1		№№ КОИТ.	БКМ		№№ КОИТ.	ЧОИП	
1	III-5	СМБ	1	III-6	СМБ	1	III-7	СМБ	1	III-27	СМБ	1	III-28	СМБ	1	III-29	СМБ
2	425-12		2	22-621-72		2	22-626-62		2	421-82		2	22-621-62		2	22-41-К37	
3	4		3	4		3	4		3	4		3	4		3	4	
4	3		4	3		4	3		4	3		4	3		4	3	
12						12			12	422-61					12		
11	22-712-11					11			11	63III-29	СПБ				11		
13	52-К75	712-22				13			13						13		
22	22-633-3					22	5-32		22						22		
21	22-633-42					21	631-21		21						21		
23	22-633-2					23	5-33		23						23		
32	636-31	22-322-33	32	314-121	4-22	32	22-41-К54		32			32	53	51-К149	32	22-614-23	
31	22-616-22	636-32	31	634-12		31	22-41-К52		31	422-4		31	51-К143		31	22-712-31	
33			33	4-23	112-КЖ2	33	2-53		33	22-311-31		33	52		33	4-42	
42	22-616-42		42			42	1-33		42			42	52-К91	63	42	22-41-К57	
41	22-616-41		41			41	63III-3	СПБ	41			41	22-625-83		41	22-322-13	
			43									43	22-324-63	62			
52	22-614-11		52			52	22-624-51		52			52	52-К143	33	52	22-612-83	
51	616-61		51			51	22-41-К5		51			51	22-41-К56		51	421-73	22-713-42
			53									53	4-33	32			
62			62	22-41-К41		62	51-К145		62			62	43		62	421-71	22-713-41
61			61	63III-2	СПБ	61	51-К147		61			61	22-625-63		61	63III-30	СПБ
63			63			63	51-К141		63			63	42		63		
72						72			72						72		
71						71			71						71		
73						73			73						73		
82						82	22-41-К83		82						82		
81	63III-1	СПБ				81	22-41-К85		81						81	425-82	
83	22-811-31					83	22-113-Ж2		83						83	22-615-63	СМБ

Вид с монтажной стороны

62III-СМБ

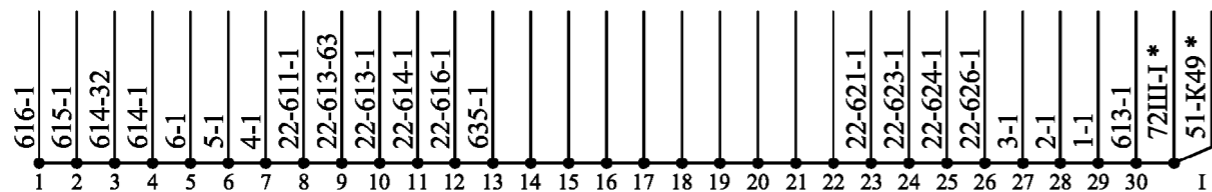

Полка №62  
Статив №23


Лист

9

6			5			4			3			2			1		
№№ КОИТ.	ЧСА		№№ КОИТ.	ПА		№№ КОИТ.	ЧСП		№№ КОИТ.	ЧСП1		№№ КОИТ.	2П		№№ КОИТ.	1П	
1	22-41-K128		1	62Ш-13	СМБ	1	52-K29	3	1	3		1	52-K25		1	52-K21	
2	22-812-61		2	814-71		2	4		2	4		2	52-K23		2	52-K19	
3	4		3	4		3	1		3	1	4-4	3	4		3	4	
4	3		4	3		4	2	3-3	4	2	52-K27	4	3		4	3	
			12	313-11		12	625-31	22-811-13	12	22-624-41		12	52-K94		12	22-626-32	
			11	313-82		11	22-811-12		11	22-514-52		11	52-K92		11	22-41-K59	
			13	313-81		13	111-ПКЖ2		13			13			13	52-K149	
			22	22-41-K4		22	816-61		22	22-624-71		22			22	22-41-K71	
			21	22-41-K147		21	52-K51		21	22-514-72		21	22-42-K28		21	624-21	
			23	22-41-K149		23			23			23	4-63 1-83	С	23	52-K15	
32	626-31		32			32	425-61		32			32	Ш-25	СПБ	32	Ш-27	СПБ
31	626-32		31	313-1		31	315-12		31			31	22-622-32		31	22-625-32	
33			33	713-21 73	СОБ	33			33			33			33		
42	22-42-K17		42			42	22-632-61		42			42	52-K52		42		
41	Ш-4	СПБ	41			41	22-722-52		41			41	Ш-26	СПБ	41		
43																	
52			52			52	22-632-11		52			52	52-K90		52		
51			51			51	22-622-12		51			51	52-K88		51		
53																	
62			62	22-41-K117		62			62	22-624-31		62			62		
61			61	22-41-K115		61	22-42-K62		61	22-311-52		61	1-61 4-83	ОХ	61	22-811-51 2-61	ОХ
63			63	22-41-K119		63	711-21 2-23	С	63	22-314-62		63	1-63	112-0	63	2-63	22-811-52
			72			72	424-12	22-632-42	72			72			72	Ш-28	СПБ
			71	22-41-K6		71	22-324-82		71			71	22-41-K61		71	613-2	
			73	33 51-K11	СОБ	73			73			73	52-K147		73		
			82			82			82			82			82		
			81			81	22-811-72		81			81			81	22-42-K60	
			83			83	2-61 115-14	ОХ	83			83			83	2-23 611-41	С

Вид с монтажной стороны

63Ш-СПБ

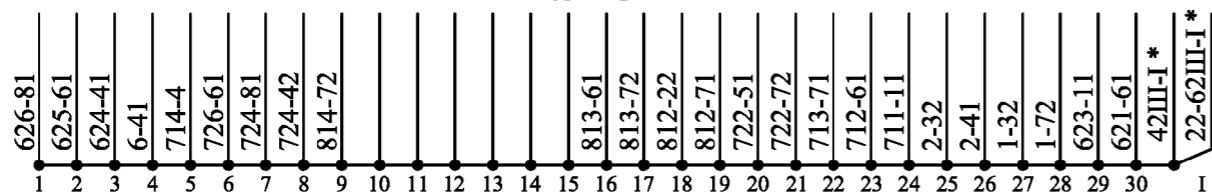

Полка №63  
Статив №23

Лист

10

6			5			4			3			2			1		
№№ КОНТ.	Конденсатор		№№ КОНТ.	Конденсаторы		№№ КОНТ.	Ч1Н2		№№ КОНТ.	Ч2Н		№№ КОНТ.	Ч1Н1		№№ КОНТ.	Ч1Н	
						1	1-72		1	72Ш-27	СМБ	1	72Ш-28	СМБ	1	2-4	
						2	3		2	3		2	3		2	3	
						3	2		3	2		3	2		3	2	
	С1			С1		4	63Ш-5	СПБ	4	312-112		4	1-1		4	2-42	
12	426-42		12	426-32		12	22-42-К40		12			12			12		
11	72Ш-1	СМБ	11	72Ш-3	СМБ	11	52-К46		11	814-13 21	СОБ	11	726-81		11	63Ш-24	СПБ
				С2		13	22-42-К42		13	22-512-81		13	22-42-К38		13	312-12	
			22	22-722-83		22			22	22-724-81		22	626-13	22-321-21	22	413-41	
			21	72Ш-2	СМБ	21			21	11 635-33	СОБ	21	22-712-13		21	33 634-63	С
						23			23			23			23	414-51	
						32			32	22-515-31		32	724-21		32	22-713-62	
						31			31	22-814-42		31	314-112		31	721-61	
						33			33			33			33	724-61 21	С
						42	413-43		42	22-724-43		42	312-22	1-4	42	72Ш-29	СМБ
						41	22-42-К44		41	722-13 426-12	ЧСП	41	312-21		41	721-42	
						43	414-53		43			43			43	22-814-51	
						52			52	22-724-63		52	724-41		52		
						51			51	722-63 615-82	ЧСМ	51	314-132		51	52-К32	
						53			53			53			53	22-311-51	
						62			62			62	52-К48	22-712-22	62	615-81	
						61			61			61	63Ш-23	СПБ	61	415-63	
						63			63			63			63	414-1	
						72			72			72			72	4-1	
						71			71	63Ш-22	СПБ	71			71	72Ш-30	СМБ
						73			73	726-4	22-512-12	73			73		
						82			82			82	312-131		82	615-31	
						81			81			81	22-616-62		81	415-13	
						83			83			83			83	414-3	


Вид с монтажной стороны

6			5			4			3			2			1		
№№ КОНТ.	ЧЗИП		№№ КОНТ.	БК8		№№ КОНТ.	ЧЗИП		№№ КОНТ.	БК7		№№ КОНТ.	ЧОВ		№№ КОНТ.	ЧЗИП1	
1	III-4	СМБ				1	III-9	СМБ				1	III-25	СМБ	1	III-26	СМБ
2	3					2	3					2	3		2	3	
3	2					3	2					3	2		3	2	
4	416-32	713-73				4	22-721-82	416-22				4	415-82		4	4-82	
			12	416-31		12			12	416-11	32	12	414-4				
			11	III-7	СМБ	11			11	III-22	СМБ	11	415-12				
						13						13	52-К138 713-41	ЧСП			
22						22	III-8	СМБ				22	22-715-61		22	22-712-21	
21	4-62					21	712-32					21	22-723-21	414-22	21	6-62	
23	22-42-К66					23						23			23		
			32	52		32			32	12		32	414-33				
			31	III-6	СМБ	31			31	III-23	СМБ	31	414-31				
						33						33					
42						42	63III-8	СПБ				42			42	22-712-42	711-41
41						41	712-52					41			41	22-315-22	
43						43						43			43	22-515-32	
			52	416-21	32	52	314-141		52	22-721-4		52	22-42-К19				
			51	III-5	СМБ	51	22-324-42		51	III-24	СМБ	51	63III-20	СПБ			
						53						53					
62	1-21					62	6-21					62	414-2		62	22-42-К34	
61	63III-6	СПБ				61	6-82 711-33	С				61	415-62		61	711-31	
63						63						63	22-723-42 713-51	ЧСМ	63	22-42-К36	6-83
			72			72	22-324-71		72			72	63III-21	СПБ			
			71			71	314-122		71			71	415-72				
						73	314-123	22-324-73				73					
82	22-713-61 4-61	С				82	1-4					82	22-715-82		82		
81	712-11					81	63III-7	СПБ				81	22-715-81		81		
83	1-63					83						83			83		

\* - монтировать проводом 2,5 мм.кв.

Вид с монтажной стороны

72III-СМБ

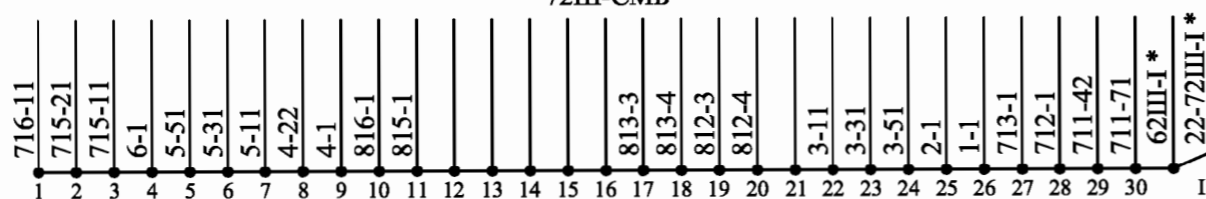

6			5			4			3			2			1		
№№ КОИТ.	НОС1		№№ КОИТ.	МП		№№ КОИТ.	А		№№ КОИТ.	ОПП		№№ КОИТ.	АВ		№№ КОИТ.	БКТ	
1	72III-10	СМБ	1	72III-11	СМБ	1			1	22-812-81		1	22-815-81		1		
2	3		2	22-42-K124	ПП	2			2	22-41-K114		2	22-42-K1		2		
3	2		3	11		3	4 51-K16	СХ	3	72III-17	СМБ	3	72III-19	СМБ	3		
4	22-722-1		4	22-42-K122		4	12	3	4	72III-18	СМБ	4	72III-20	СМБ	4		
12			12	311-33		12	4 3-51	СХ	12	1-11		12	42		12	11	
11			11	3		11	51-K2	С	11	22-52-10-2	31	11	52-K79		11	3-12	12
13			13			13	713-11 22-814-21	СОБ	13			13	22-635-71		13		
22			22	22-42-K144					22			22	63III-18	СПБ	22		
21			21	311-1		21			21			21	22-41-K110		21		
23			23						23			23			23		
32			32			32	115-V2	41	32	22-41-K32		32			32	31	
31			31	311-131		31	51-K8	МС	31	11	2-42	31			31	32	
33			33	22-42-K148		33	51-K57	ОСМБ	33			33			33	22-41-K26	
42			42						42			42	3-31	12	42		
41			41	311-42		41	61	32	41			41	52-K145		41		
43			43	311-141					43			43	22-41-K34		43		
52	22-611-11		52			52	22-41-K111		52	2-82		52			52	51	
51	22-622-22		51			51	22-41-K109		51	4-12 2-81	СХ	51			51	52	
53			53			53			53			53			53	22-41-K28	
62	22-613-61		62						62	22-42-K13		62			62		
61	634-22		61			61	41		61	63III-16	СПБ	61			61		
63			63						63			63			63		
72			72			72	63III-9	СПБ	72	63III-17	СПБ	72	22-42-K15		72	71	22-635-72
71			71			71	635-2		71	22-41-K116		71	63III-19	СПБ	71	72	22-41-K30
73			73			73			73			73			73		
82			82						82			82	3-52	22-42-K112	82		
81			81			81			81			81	22-52-9-1 3-51	СХ	81		
83			83						83			83			83		

Вид с монтажной стороны